
PROPER USE GUIDELINES

Cumulative Trauma Disorders can result from the prolonged use of manually powered hand tools. AMP hand tools are intended for occasional use and low volume applications. AMP offers a wide selection of powered application equipment for extended—use, production operations.

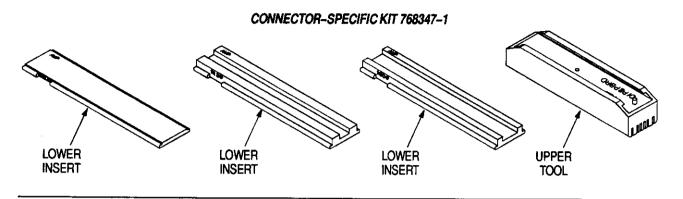

TYPICAL APPLICATIONS

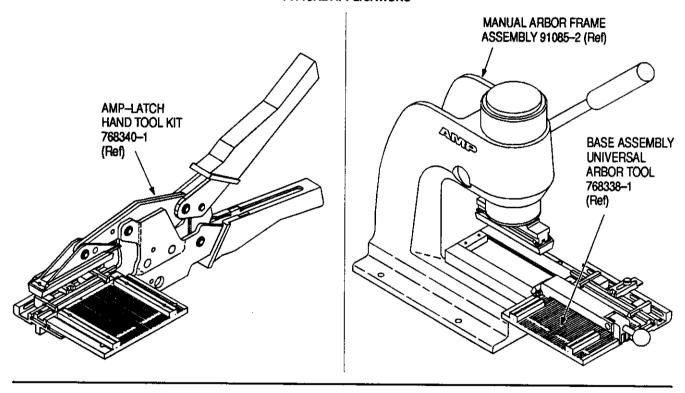


Figure 1

cad

1. INTRODUCTION

*Trademark

This instruction sheet describes AMP Connector– Specific Kit 768347–1, lists cable requirements, and describes installation of the connector–specific kit. (See Figure 1.)

The connector-specific kit is used with Base Assembly Universal Arbor Tool 768338-1 or

AMP-LATCH Hand Tool Kit 768340-1 (Figure 1) to terminate AMP-LATCH DIP Connectors to ribbon cable with 1.27 mm [.050-in.] centerline spacing. See Figure 2.

The Base Assembly Universal Arbor Tool is powered by either AMP Manual Arbor Frame Assembly 91085–2 or AMP Pneumatic Frame Assembly 91112–3.



NOTE

For information concerning AMP-LATCH DIP Connectors, refer to AMP Catalog 82012. For detailed information on other tooling components used with the Connector-Specific Kit 768347-1, refer to the following publications:

408–6732 -- Pneumatic Auto-Cycle Unit 91112–3

408-7777 -- Manual Arbor Frame Assembly 91085-2

408–9827 -- Base Assembly Universal Arbor Tool 768338-1


408-9828 -- AMP-LATCH Hand Tool Kit 768340-1

NOTE

All dimensions are in metric units [with U.S. customary units in brackets].

2. DESCRIPTION (Figure 1)

The connector–specific kit features an upper tool and three lower inserts. The upper tool applies an even force over the length of the connector during termination. Each lower insert positions the connector on the tooling assembly. Each component is marked "AMP DIP."

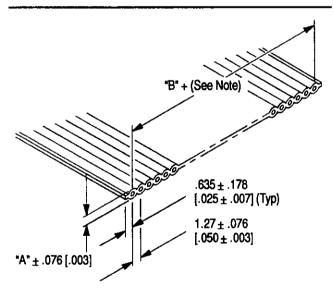

NOTE
ACCUMULATIVE TOLERANCE FOR CABLE CONDUCTORS 1 THROUGH
34 IS + .254 [.010] AND THROUGH 60 IS + .38 [.015].

CONDUCTOR		DIMENSION		
SIZE (AWG)	. TYPE	"A"	"B"	
26	Stranded or Solid	0.889 mm	1.27 mm [.050 lN.] X (Total No. of	
28	Stranded or Solid	[.0351N.]	Conductors	
30	Solid	•	Minus One)	

Figure 2

cad 9831

3. CABLE REQUIREMENTS

The connector–specific kit will terminate AMP–LATCH DIP Connectors with 1.27 mm [.050–in.] centerline spacing to ribbon cable with No. 26 AWG solid or stranded conductors, No. 28 AWG solid or stranded conductors, or No. 30 AWG solid conductors. Refer to Figure 2 for the recommended cable dimensions.

CAUTION

The cable must be cut 90° to the edge of the cable; otherwise an improper termination will result. We suggest you use a guillotine-type cable cutter, such as the Carpenter Model 95 which can be purchased from:

Carpenter Manufacturing Co., Inc. Fairgrounds Drive Manlius, N.Y. 13207

AMP-LATCH HAND TOOL KIT 768340-1 (Ref) (Includes AMP-LATCH Hand Tool Subassembly 768942-1 and Base Assembly Universal Hand Tool 768339-1. Refer to 408-9846 and 408-9826)

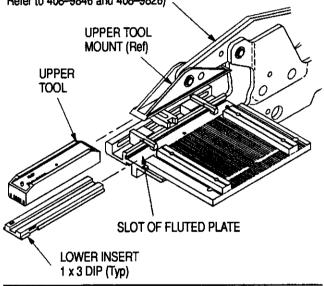


Figure 3

cad

4. CONNECTOR-SPECIFIC KIT INSTALLATION (Figures 3 and 4)


NOTE

For hand tool applications, mount the hand tool onto a suitable work surface, whenever possible, before terminating the connectors. Refer to the bench-clamping instructions in instruction sheet 408-9828, packaged with the AMP-LATCH Hand Tool Kit.

- 1. Slide the upper tool onto the upper tool mount.
- 2. Select the lower insert, according to the style connector being terminated, and slide the insert into the slot of the fluted plate.

This completes the installation procedure.



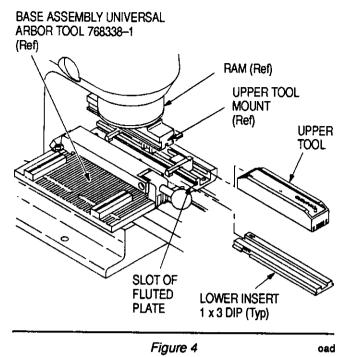

NOTE


For information concerning termination procedures, refer to 408–9828 packaged with the AMP-LATCH Hand Tool Kit, and 408–9827 packaged with the Base Assembly Universal Arbor Tool.

5. CONNECTOR-SPECIFIC KIT INSPECTION

Connector–Specific Kit 768347–1 has been inspected and should be verified with the information provided in Figure 5. It is recommended that the connector–specific kit be inspected immediately upon its arrival at your facility (and at regularly scheduled intervals) to ensure that the kit components have not been damaged during handling.

For additional information concerning connector– specific kits, contact your local AMP representative or:

CUSTOMER SERVICE (38–35) AMP INCORPORATED P.O. BOX 3608 HARRISBURG, PA 17105–3608

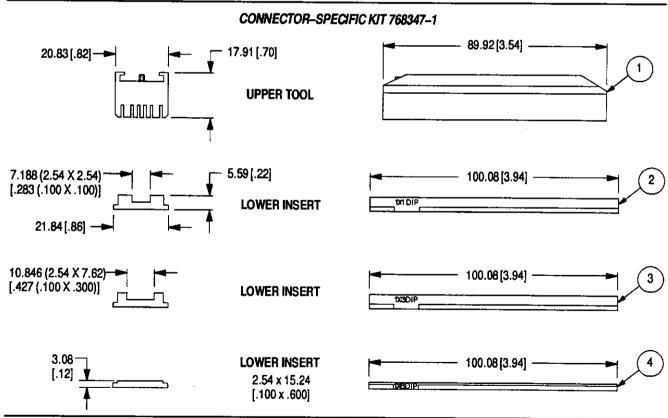

COMPONENT LIST					
ITEM NO.	PART NUMBER	DESCRIPTION	QTY		
1	543274-5	Upper Tool	1		
2	5432755	Lower Insert	1		
3	543275-6	Lower Insert	1		
4	543275-7	Lower Insert	1		

Figure 5

cad